

## Vision<sup>®</sup> Stud Retainer Assembly Repair

The following information is provided to help you replace the seat and back insert stud retainer assembly.

### Tools Needed

- Special 6LN Vice-Grip<sup>®</sup> clamp (AmSeCo part number: 162562)

### Retainer Assembly



Remove broken or malfunctioning stud retainer assembly. **Note:** Upper retainer assembly is not used for Non-Upholstered (Vision-NU) seat backs.




Position one stud retainer bottom behind the back strap and lined up with the openings. (AmSeCo part number: 114880000)



Hold in place with clamp bottom ("U" shaped section).



Position top of stud retainer assembly (two parts, see next image) and firmly clamp together to secure.

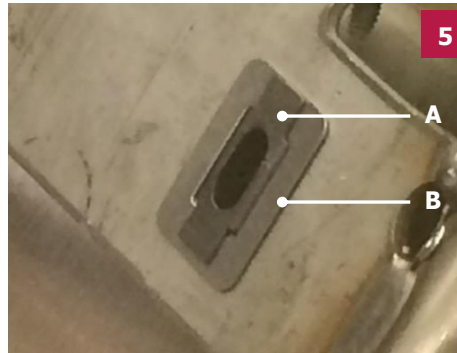

Repaired stud retainer. Item A is the stud retainer upper and item B is the guard. (AmSeCo part numbers A: 114879000 and B: 155451500)



**Note:** All other locations use two (2) stud retainers under thinner (formed) straps. Front seat strap shown.